

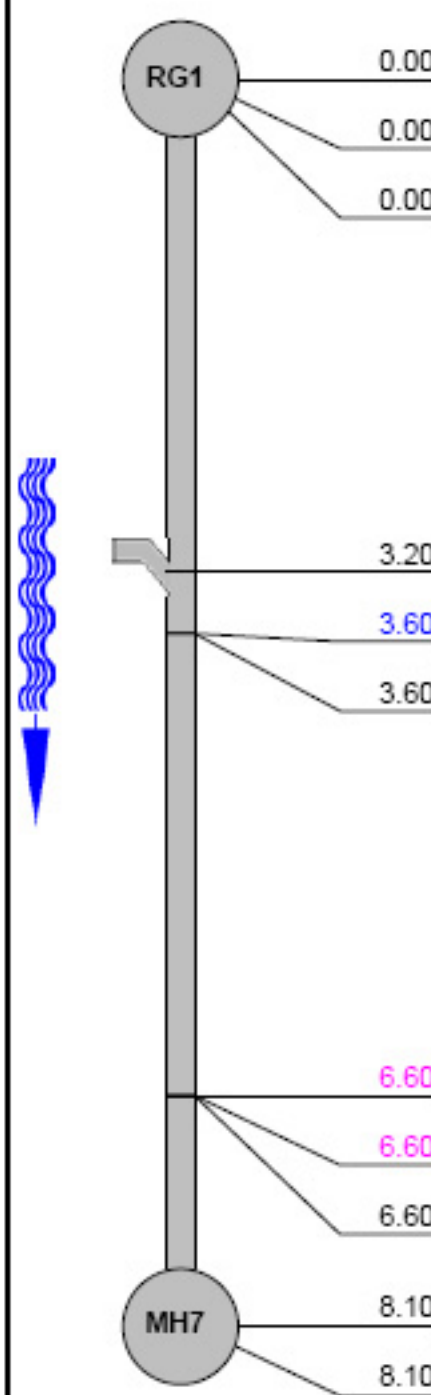


Inspection report

Date: 01/04/2010	Job N°: PG651	Weather: DRY	Operator: PG	section number: 29	PLR: RG1 X
Video Volume No.:	Vehicle:	Camera:	Preset:	Cleaned: Yes	Grade:

Road: OLD STREET ROUNDABOUT	Map No.1:	start MH: RG1
Place: LONDON	Map No.2:	end MH: MH7
Location:	Tape No.: 00029	Total length: 8.1 m

Purpose:	Shape/Size: Circular 150
Section use: surface water	Material: Vitrified Clay Pipe length:
Catchment:	Lining:

Comment:

1:75	position	code	observation	photo	grade
	0.00	ST	Start of Survey		0
	0.00	MH	Manhole Remark: RG1		0
	0.00	WL	Water level, 5 % height/diameter		0
	3.20	JN	Junction at 03 o'clock, dia 150 mm		0
	3.60	JDL	Joint displaced. Large		2
	3.60	LD	Line of Sewer deviates down		0
	6.60	H	Hole in sewer from 07 to 08 o'clock		4
	6.60	FM	Multiple Fractures from 12 to 12 o'clock		4
	6.60	LD	Line of Sewer deviates down		0
	8.10	MH	Manhole Remark: MH7		0
	8.10	FH	Finish Survey		0